 


Date: Monday, 1/8/2007 10:20:21 AM  
 User: Kim Johnston

## Process Sheet

<b>Customer</b> :	CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> :	SKIDTUBE ASSEMBLY
<b>Job Number</b> :	30101		
<b>Estimate Number</b> :	10022		
<b>P.O. Number</b> :	N/A	<b>Part Number</b> :	D205634011
<b>This Issue</b> :	1/8/2007	<b>Drawing Number</b> :	N/A
<b>Prsht Rev.</b> :	NC	<b>Project Number</b> :	N/A
<b>First Issue</b> :	N/A	<b>Drawing Revision</b> :	N/A
<b>Previous Run</b> :	30100	<b>Material</b> :	N/A
<b>Written By</b> :		<b>Due Date</b> :	1/30/2007
<b>Checked &amp; Approved By</b> :			
<b>Comment</b> :	Est Rev:P 02.08.28 Removed QC5 from Step 5 KJ		

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D205-634-011 CHG004

KS 07.01.31 (1)

2.0	30101A	SKID TUBE ASSEMBLY
-----	--------	--------------------



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B 30101 A

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K10003	D205-634-011 Saddle Kit
-----	--------	-------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)


Pick:

Qty Part Number Description Batch

1 K10003 Saddle Kit

1 D205-634-041 Skidtube Assembly(ref)

529768  
 530101 A

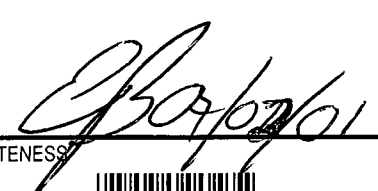

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

PC 7/22/01 (1)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☐ No ☒ DQA:   R   Date: 07/02/05

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/8/2007 10:20:21 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 30101

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-824-011

Location: REV: H

REV: H

07/02/01

07/02/01

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/02/05

Job Completion



070202

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_









QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: SKID TUBE ASSEMBLY
Job Number	: 30101A		
Estimate Number	: 10023		
P.O. Number	: N/A	Part Number	: D205634041
This Issue	: 1/8/2007	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D2580 REV C
First Issue	: N/A	Project Number	: N/A
Previous Run	: 30100A	Drawing Revision	: C
		Material	: N/A
Written By	: _____	Due Date	: 1/30/2007
Checked & Approved By	: _____	Qty:	1 Um: Each
Comment	: Est Rev: N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ		
	: Est Rev. O 06.02.28 Added paperwork EC		

## Job Number:

Seq. #:	Machine Or Operation:	Description :								
1.0	DC	DOCUMENT CONTROL								
<div></div>										
<div>Comment: DOCUMENT CONTROL</div> <div>Photocopy D205-634 bluefile &amp; type labels per PPP D205-634 CHG001</div>										
2.0	D25001190	Ext'n -I' Beam Tube 4"								
<div></div>										
<div>Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)</div> <div>Pick:</div> <table><thead><tr><th>Qty</th><th>Part Number</th><th>Description</th><th>Batch</th></tr></thead><tbody><tr><td>1</td><td>D2500-1-190</td><td>Skid Tube Extrusion</td><td>B 25858</td></tr></tbody></table> <div>op 7-1-9 ①</div>			Qty	Part Number	Description	Batch	1	D2500-1-190	Skid Tube Extrusion	B 25858
Qty	Part Number	Description	Batch							
1	D2500-1-190	Skid Tube Extrusion	B 25858							
3.0	D2596	205 Web								
<div></div>										
<div>Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)</div> <div>Pick:</div> <table><thead><tr><th>Qty</th><th>Part Number</th><th>Description</th><th>Batch</th></tr></thead><tbody><tr><td>1</td><td>D2596</td><td>205 Web</td><td>B 29723</td></tr></tbody></table> <div>p/jb 7-1-11 ①</div>			Qty	Part Number	Description	Batch	1	D2596	205 Web	B 29723
Qty	Part Number	Description	Batch							
1	D2596	205 Web	B 29723							
4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1								
<div></div>										
<div>Comment: LANDING GEAR RESOURCE 1</div> <div>1- Inspect mat'l D2500-1-190 for damage</div> <div>2-Cut D2500-1-190 per Dwg D2580 if necessaryDeburr ends</div> <div>3-Acid etch and Alodine tube per QSI 005 4.1</div> <div>4-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)</div> <div>p/jb 7-1-10 ②</div>										

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/8/2007 10:21:02 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30101A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty	Part Number	Description	Batch
A/R	Sikaflex-291	102672	
Sikaflex expire date: 07-02-01			
Start Time: 9:00		Date: 7-1-11	
Fin Time: 11:00am		Date: 7-1-15 EL	

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step 329486	BE 7-01-18

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Monday, 1/8/2007 10:21:02 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30101A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total: 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	B29603

BE 07-01-18

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

BE 07-01-18

2-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R Aluminum Rod

M102756

BE 07-01-18

3-Grind welds as per Dwg D2580 Grind flush ridge made from bending

pm 07-01-18

4-Drill holes for wearplates using DT 8217 Open holes to 19/64", adjust stopper not to hit web. Deburr

pm 07-01-18

5-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

pm 07-01-18

6-Drill pilot holes for aft cap using DT 8215 Open holes to #6 Drill bit. Deburr

pm 07-01-18

7-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

pm 07-01-18

8-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R Aluminum Rod

M102756

BE 07-01-18

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/01/22

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/01/22

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Monday, 1/8/2007 10:21:02 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30101A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



M1103141



①

Comment: HAND FINISHING RESOURCE #1

Powder Coat White (Ref: 4.3.5.2) as per QSI 005 4.3

MJR 1

07/01/23

14.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

07/01/23

①

15.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-1	Wearplate	29488

16.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-3	Wearplate	29326

17.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2577-5	Wearplate	28639

18.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	ALS7-1032-130	Inserts	102475

gl 07/01/23

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/8/2007 10:21:02 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30101A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN960JD10L	Washer	102217

20.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN3-4A	Bolt	103154

21.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: 29490

22.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: 27168

23.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: 27488

24.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: 15205

48 07/01/29

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: TD Date: 07/02/05  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 1/8/2007 10:21:02 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001-Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30101A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: 102217

YH 07/01/29

26.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291

Sikaflex expire date: 02/07

102672

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 02/07

102672

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

m 102098

FR

Batch

07/01/30

①

27.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

MM 07 01 30

①

28.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PPP B30101

07/02/05

29.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

07/02/05

N 07-02.02

W/O:		WORK ORDER CHANGES							
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

RELEASED  
98/09/17 DS

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576 - 3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER

# 00 08.28  
CP 00.08.28


EFFECTIVE DEOS  
98/12/14  
DEO 9124  
DED 9183

#### GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES \*
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR SHOP COPY WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

UNCONTROLLED COPY  
RETURN TO  
ENGINEERING  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 30101A


DETAIL A  
SCALE 5:24

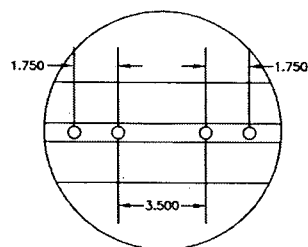


DETAIL B  
SCALE 5:24

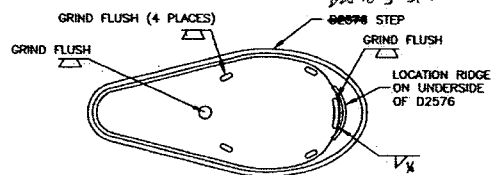


DETAIL C  
SCALE 5:24

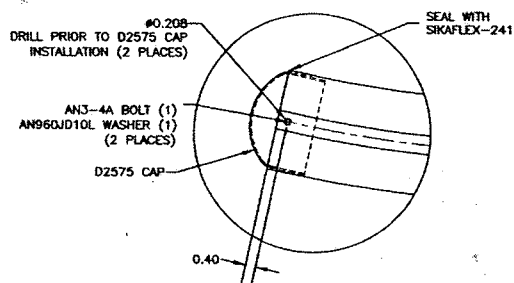


SECTION D-D  
SCALE 5:24

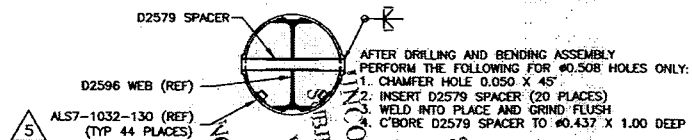


D2580-1 DRILLING DETAIL

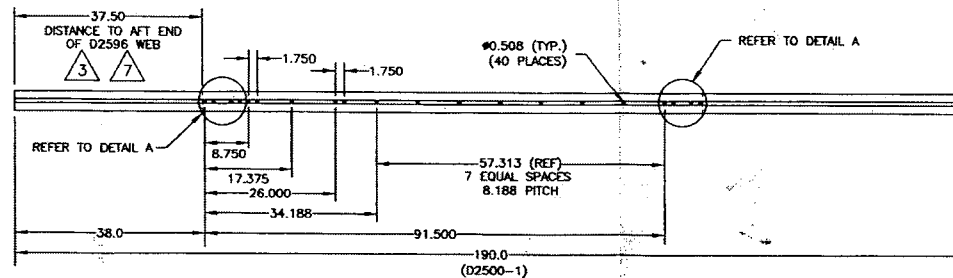

D2580-1 BENDING AND CUTTING DETAIL

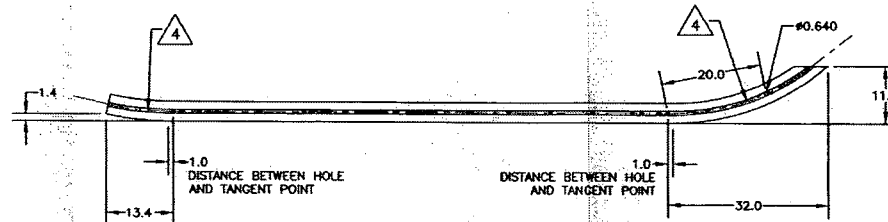

D2580-041 ASSEMBLY DETAIL

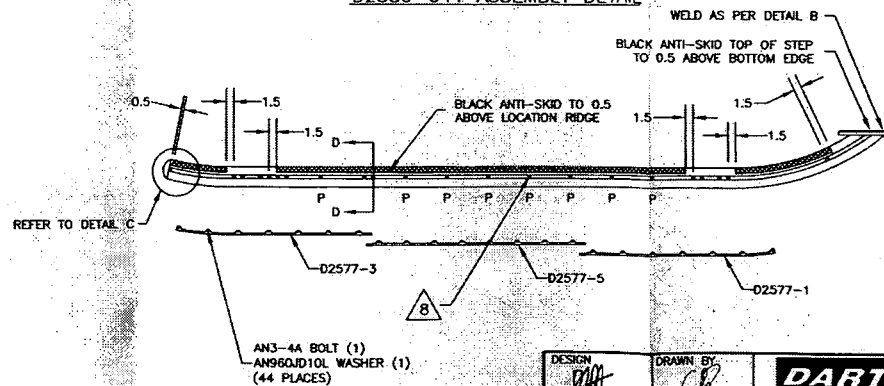

RELEASED  
98/07/17 - 05

DESIGN DART	DRAWN BY DART	DART AEROSPACE LTD HARRISBURG, ONTARIO, CANADA	REV. C
CHECKED DART	APPROVED DART	DRAWING NO. D2580	SHEET 2 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 30101A

NO. 90

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay Elliott  
Joint Welding Procedure Tig  
Part number and Job number D205 634041 / B32102 A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into NA Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/01/17

Qualifier David Aweel

Date: Friday, 09/02/2007 9:59:35 AM  
 User: Linda Lacelle

## Process Sheet

Customer	: CC-DAR01 Dart Aerospace Ltd.	Drawing Name	: D205-635 / D204-635
Job Number	: 30722		
Estimate Number	: 10804		
P.O. Number	: N/A	Part Number	: Z-CUSTOM ECN952/908
This Issue	: 09/02/2007 S.O. No. : N/A	Drawing Number	: UPDATE PAPERWORK
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: N/A Type : OVERHEAD	Drawing Revision	: N/A
Previous Run	: 00015	Material	: N/A
Written By	:	Due Date	: 16/02/2007 Qty: 1 Um: Each
Checked & Approved By	:		
Comment	:		

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

ADD NEW PAPERWORK TO KITS IN STOCK

TC STC SH96-88, ISSUE 3 / FAA STC SR00563N4

D205-634-011

D205-634-041

D205-634-043

D205-634-045

D204-635-011

D204-635-041

voir papier  
 avec ✓

7/4/27 SQ

2.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

RETURN TO STOCK

7/4/27 SQ